
## H-60 WIRING SYSTEM AWARENESS

### PREVENTING WIRING SYSTEM FAILURE SAVES


Strap ties in contact with structure, or other wire bundles, are not authorized.

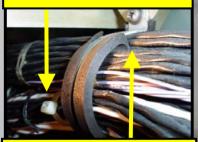

Clamp rubber insert rotated, inducing chafing. Wiring must be contained in the rubber insert/cushioning.

## TIME, MONEY...

#### AND LIVES!

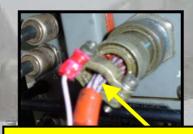

Tape build-up for strain relief at backshell is inadequate, should provide gripping ability.



Miscellaneous Relay Panel power wiring missing routing support at bulkhead pass through, inducing chafing.



Distorted clamp with worn rubber insert = chafing.

# ALWAYS MAINTAIN THE CORRECT WIRING SYSTEM CONFIGURATION!

